INSTALLATION INSTRUCTIONS FOR STEM HUNG & CORD HUNG RLMs

!!! Important !!!

Fixtures must be installed according to the instructions provided to avoid field failure! Make sure all power is disconnected prior to installation.

Wiring to be done according to Local and National Electric Codes by a qualified

Stem Hung RLM

1.Pre-wired socket comes assembled to adapter. Verify O-ring is in place.

Important: O-ring must be installed for Wet Location

- 2. Insert socket assembly into fixture.
- 3. Slide the cast nut down the leads and thread onto the adapter. Note: The nut is left-hand thread.
- 4. Tighten cast nut firmly.


Cord Hung RLM

- 1.Pre-wired socket comes assembled to adapter.
- 2.Insert socket assembly into fixture.
- 3. Slide the cast nut down the leads and thread onto the adapter. Note: The nut is left-hand thread.
- 4. Tighten cast nut firmly.

Ceiling Canopy with Cord Hung RLM

- 1. Cut the cord to the desired hanging length allowing an extra 6" for wiring.
- 2. Slide cord through plastic bushing, star washer and canopy.
- 3. Thread nipple into Octagon-box bracket and slide the cord up through the nipple/Octagon-box bracket assembly.
- 4. Crimp strain relief 6" down from top of cord. Remove cord jacket just above strain relief exposing leads for wiring.
- 5. Attach nipple/Octagon-box bracket assembly to Octagon-box.
- 6. Make wiring connections and slide canopy up onto the nipple. Thread plastic bushing onto nipple holding canopy in place.

Important: Teflon tape or pipe dope must be used on stem or gooseneck threads, that will screw into fixture, to ensure "Wet Location" seal!!

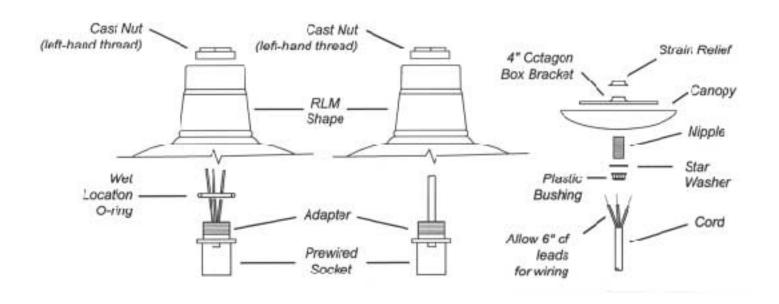

QUESTIONS? Call LSI Field Service Dept. 1 (800) 436-7600 ext 3300 Fax 1-877-861-1368

LSI Industries Inc. 10000 Alliance Road

Cincinnati. Ohio 45242 (513) 793-3200

Fax (513) 793-0147

www.lsi-industries.com

Page 1 of 2

INSTALLATION INSTRUCTIONS FOR STEM HUNG & CORD HUNG RLMs

!!! Important !!!

WARNING: Fixtures must be installed according to the instructions provided to avoid field failure!


Make sure all power is disconnected prior to installation.

Stem Hung Globe or Plate RLM

- 1. Pre-wired globe comes as an assembly. Verify O-ring is in place. **Important: O-ring must be installed for Wet Location seal!!**
- 2. Insert globe or plate socket assembly into fixture.
- 3. Slide the cast nut down the leads and thread onto the adapter. Note: The nut is left-hand thread.
- 4. Tighten cast nut firmly.
- 5. If required, tighten two screws pulling globe assembly firmly up into the fixture.

Cord Hung Globe or Plate RLM

- 1. Pre-wired globe or plate socket comes as an assembly.
- 2. Insert globe or plate socket assembly into fixture.
- 3. Slide the cast nut down the leads and thread onto the adapter. Note: The nut is left-hand thread.
- 4. Tighten cast nut firmly.
- 5. If required, tighten two screws pulling globe or plate socket assembly firmly up into the fixture.

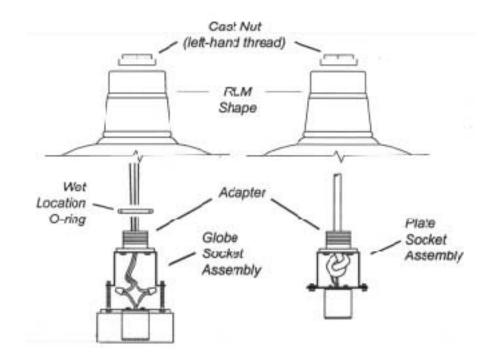

QUESTIONS? Call LSI Field Service Dept. 1 (800) 436-7600 ext 3300 Fax 1-877-861-1368

Jaj Industries^M

LSI Industries Inc. 10000 Alliance Road Cincinnati, Ohio 45242 (513) 793-3200

200 Fax (513) 793-0147

www.lsi-industries.com